


PMI® CORDE-LITE™



7mm diameter x 6.4 m (21 ft) PMI Lumi Line

Weight: 34.5 g/m

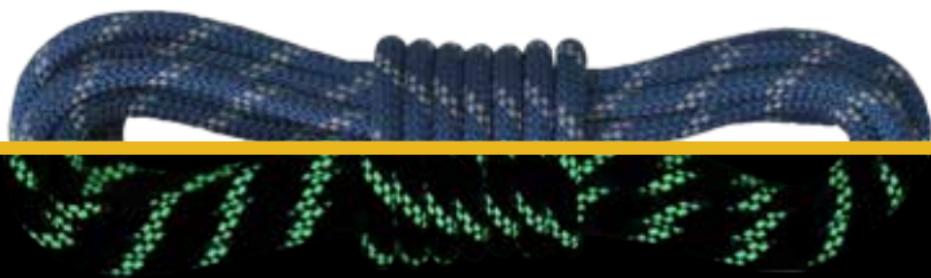

Glow in the Dark

The PMI® CORDE-LITE™ literally stands out from any other accessory cord! This is a one-of-a-kind accessory cord with a phosphorescent sheath that glows in the dark for up to 10 or more hours after brief exposure to a good light source.

Charge the glow cord with a brilliant artificial light or even sunlight, ensuring the cord isn't subjected to any damaging heat, and watch it glow. The PMI® CORDE-LITE™ is strong with a Minimum Breaking Strength of 2,665 lbs. (11.85kN) and is certified to UIAA 102, so it can be used for rigging and climbing applications. It looks great, has a solid feel, excellent knotability and provides outstanding visibility like no other accessory cord!

The PMI® CORDE-LITE™ Manufacturer's Instructions are located on the inside of the hang tag. Be careful when opening the tag so that the instructions remain legible.

Lot# _____

CC070UG006S

RM00214

PMI and CORDE-LITE™ are trademarks or registered trademarks of Pigeon Mountain Industries Inc. LaFayette, GA 30728 | www.pmirope.com

For questions about this product call (800) 282-7673.



PMI® CORDE-LITE™ MANUFACTURER'S

INSTRUCTIONS

ABOUT YOUR PERSONAL SAFETY

- You are responsible for your own safety and decisions while using this product.
- Special training and knowledge are required to use this product. This cord is intended for use by those who are trained and experienced in technical rope rigging and rescue applications.
- Before using this product you must thoroughly read and understand these Manufacturer's Instructions, as well as all warnings, product labels and associated information.
- Do not allow prolonged exposure of the PMI® CORDE-LITE™ to a light source that could cause enough heat to damage the cord.
- Failure to follow these stated warnings may result in serious injury or death.
- PMI is not responsible or liable in any way for damages of any kind, injury or death resulting from direct or indirect incidents related to the use of its products.

USING YOUR PMI® CORDE-LITE™

Before using your PMI® CORDE-LITE™ at height, become familiar with its features, specifications and proper use. Inspect the cord upon receiving it and before each use to ensure that it is in adequate condition for use. Read, understand and always follow each step of the section "How to Inspect Your Cord" to be competent in the inspection of your PMI® CORDE-LITE™. PMI® CORDE-LITE™(s) should be thoroughly inspected at least annually, regardless of how frequently the cord is (or isn't) used. It is up to the user to learn how to use this PMI® CORDE-LITE™ properly and apply good judgment to situations that can have serious and possibly deadly consequences. Anyone who does

use PMI® CORDE-LITE™ in life safety applications should first be trained by an instructor competent in rope rigging and vertical climbing systems.

INSPECTION AND MAINTENANCE

How to Inspect Your Cord

- Inspect by starting at the end point and look at and feel every inch of the cord. Use both hands to form a bight of cord at one end and push the cord through your hands allowing the bight to maintain its round shape for the entire length of the cord. If it doesn't maintain a rounded shape, then there might be a problem with the core and you should not use it.
- Watch for signs that might indicate possible core or sheath damage such as discoloration, chemical odors, abrasion marks, cuts, nicks and any visible differences.
- Go through the entire Retirement Criteria section of these instructions and consider each statement as a requirement for each inspection of your cord.
- Discard and destroy any cord that does not pass inspection and retirement criteria.

MAINTAINING YOUR CORD

- Create and maintain an Equipment Log for each individual cord and review it regularly. Include information such as date of manufacture, date placed in service, dates of use and conditions under which it is used, results of inspections, and other information specific to your application.
- Store your cord in a clean, dark, dry environment; away from exposure to chemicals, ultraviolet rays, prolonged excessive heat, noxious/exhaust fumes or other harmful agents.

CLEANING YOUR CORD

WASH IT - You can wash cords by hand with a non-abrasive brush or in a front-loading commercial

washing machine in a PMI® Laundry bag for keeping cord from getting tangled when washing. Wash using cool to warm water <30°C (<86°F) with a mild soap. PMI recommends using PMI® Rope Soap; otherwise non-detergent soaps are best. Soap used should not contain any bleaching agents. DO NOT use top loading washing machines with agitators because they tangle the cord(s) severely and can cause damage to the washing machine. To learn how to properly disinfect a cord from exposure to bloodborne pathogens, contact PMI at 706-764-1437.

DRY IT - Dry your cord in a clean, dry area out of direct sunlight. For best results, the cord should be hung to dry or laid in a loose coil and NOT on a surface that may leach contaminants (such as concrete).

DO NOT use a commercial dryer to dry the cord(s). **WRITE IT DOWN** - Remember to record the cleaning in the Equipment Log.

RETIREMENT CRITERIA

CUT RETIRED PMI® CORDE-LITE™ to discourage future use and discard it entirely. A retired cord should NEVER be stored, kept or maintained in such a way that it could inadvertently be used as a lifeline.

RETIRE IMMEDIATELY:

- Any cord whose strength may have been compromised during use.
- Any cord which is subjected to uncontrolled or excessive loading.
- Any cord which is greater than 10 years old, regardless of history and usage. The age of the cord is calculated from date of manufacture.
- Any cord about whose history and past usage you are uncertain.
- Any cord that has been exposed to heat, direct

flame or excessive abrasion.

- Any cord that has been visibly damaged.
- Any cord that has been exposed to liquids, solids, gases, mists, or vapors of any chemical or other material that can deteriorate the fiber from which it is made.
- Any cord that does not pass inspection when inspected by a competent person following the inspection procedures in these instructions, both before and after each use.
- Any cord when there is any doubt about the safety or serviceability.

PMI LIMITED WARRANTY

PMI products are warranted to the original retail purchaser to be free from defect in material and workmanship for a period of one year. PMI will repair or replace the item without charge provided inspection at our factory discloses no misuse or alteration, which, in our judgment, has affected the condition or functioning of the product. All implied warranties imposed by law in connection with the sale of PMI products are also limited in duration to a period of one year. PMI expressly excludes and shall not be liable for any consequential damages arising out of any breach of the express or implied warranties on sales of PMI products. Because of the high risks involved in high angle rope work such as, but not limited to, rescue, rope access, caving, rappelling, rock climbing and mountaineering, no further warranties exist or are implied by PMI. Regulations issued under the Magnuson-Moss Warranty Act require us to include the following statement: some states do not allow limitations on how long an implied warranty lasts nor the excluding or limitation of incidental or consequential damages, so the above limitations may not apply to you.